

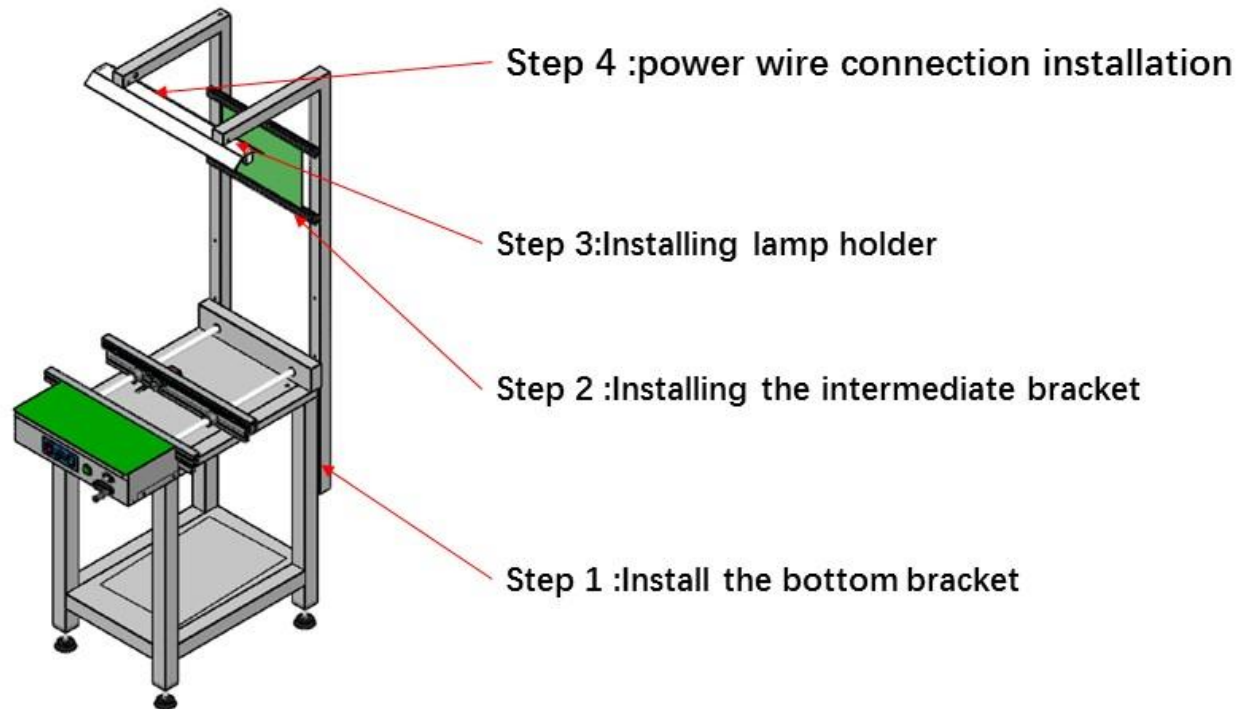


Conveyor Lighting Stand Installation Instructions

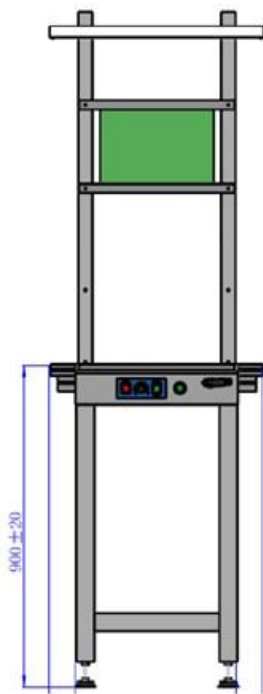


Detailed list of accessories

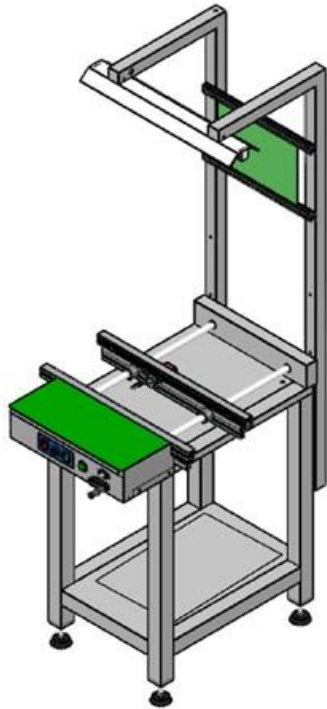

Item	Name	size	Quantity
1	1.A4 Hard rubber sleeve	A4	1
2	Energy saving lamp	1.2M	1
3	intermediate bracket	1.2M	2
4	Square light stand	1.2M	2
5	M6x65 screws	M6x65	4
6	M6x50 screws	M6x50	2
7	M4x20 screws	M4x20	4
8	M4x10 screws	M4x10	2
9	Light Power wire	1M	2
10	Top bracket	1.09M	1


Step 1 :Install the bottom bracket

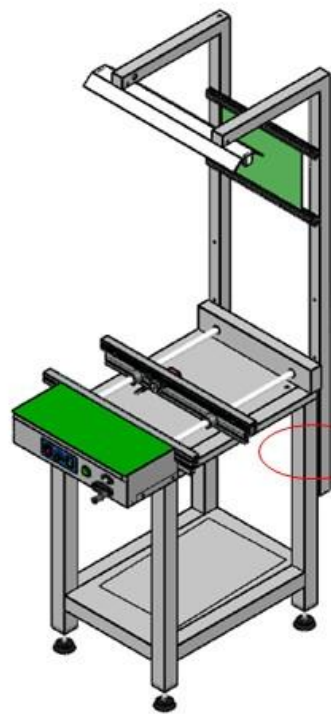

Secure the base bracket with 4 M6x65 screws
2 Square light stand




Step 2 :Installing the intermediate bracket

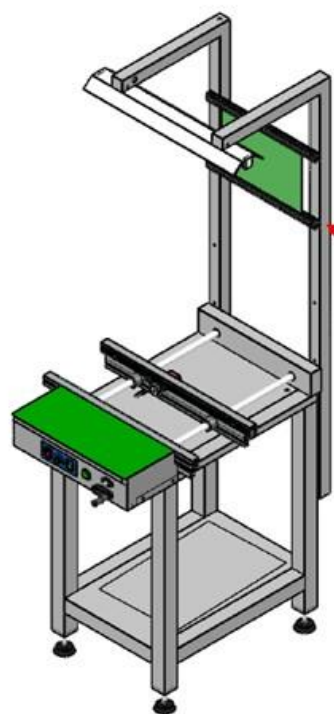


Secure the intermediate bracket with 4
M4x20 screws

Length 1.2m bracket

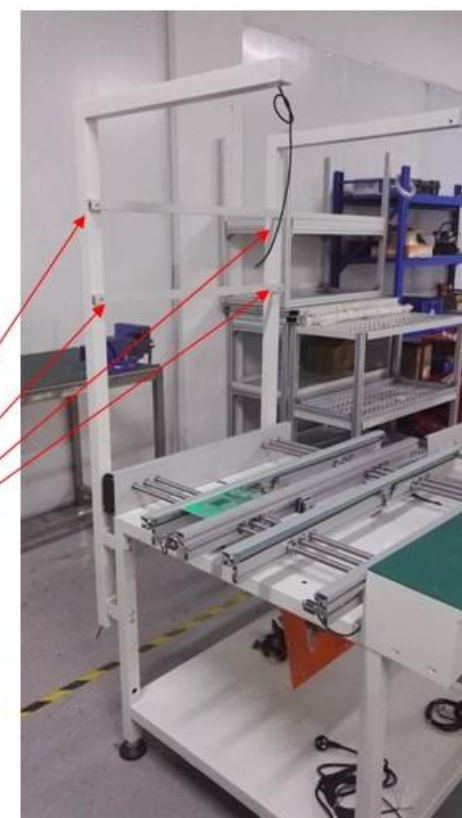

Step 3: Installing lamp holder

3.1 Use two M6X50 screws on the top to mount a 1.09 m bracket.

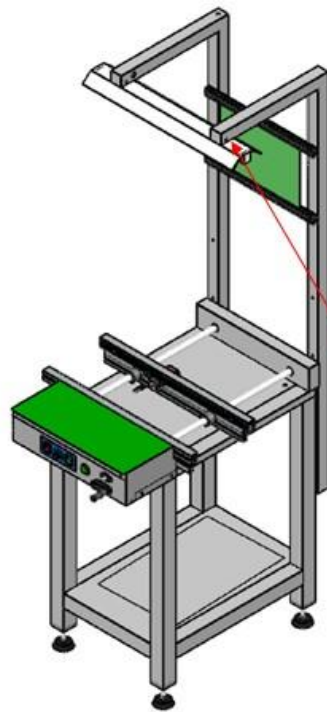

Top bracket





Length 1.09 m bracket




Step 3: Installing lamp holder

3.2 Lamp holder connector installation method

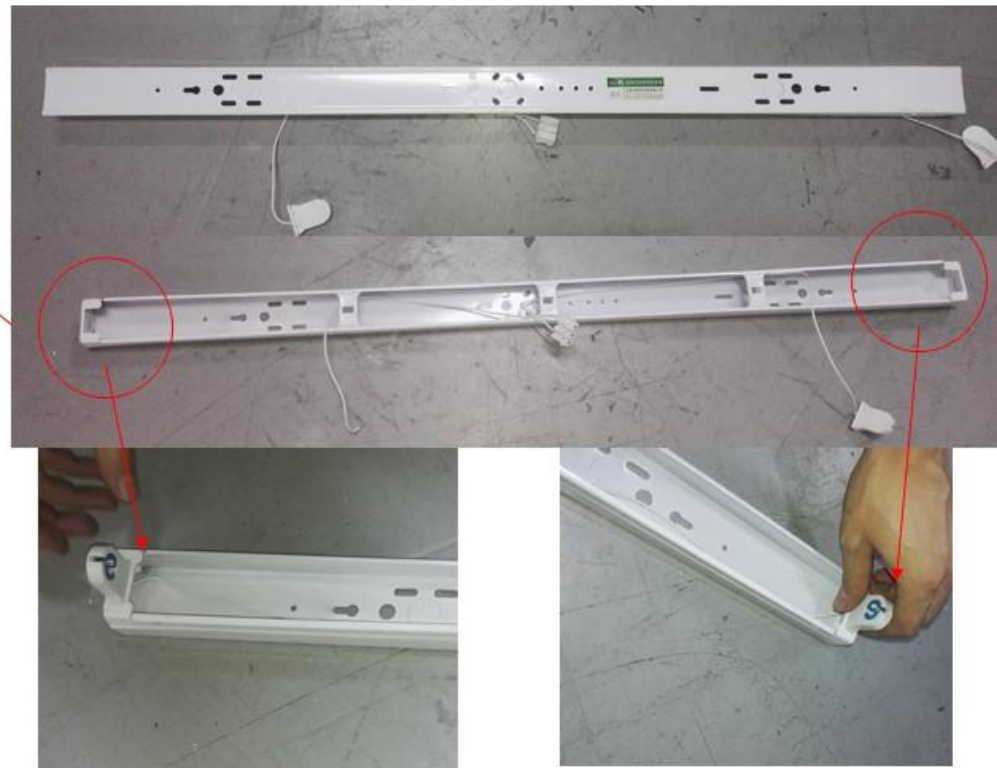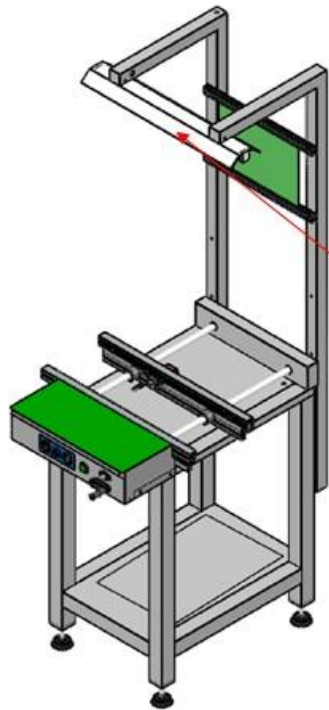



Step 3: Installing lamp holder

3.3 Fix the lamp holder to the bracket with M4X10 screws

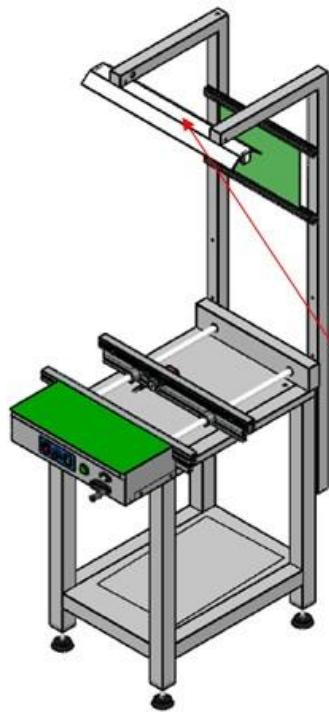


Step 3: Installing lamp holder



3.4 Light 110V power cable connection

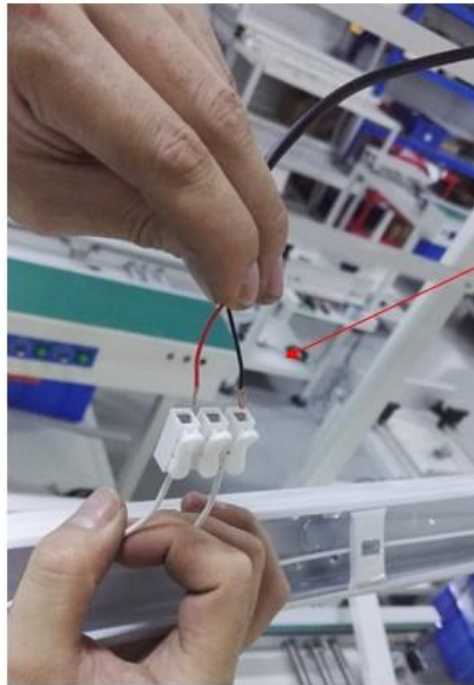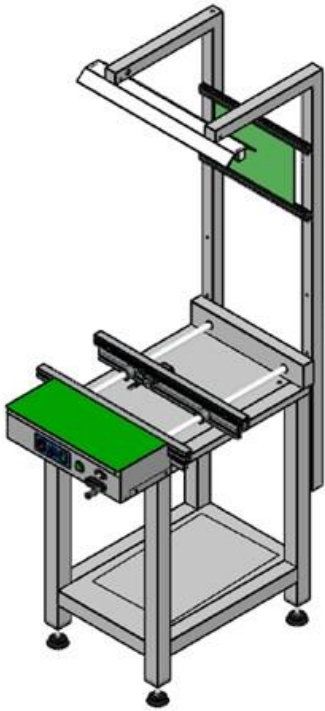

Step 3: Installing lamp holder

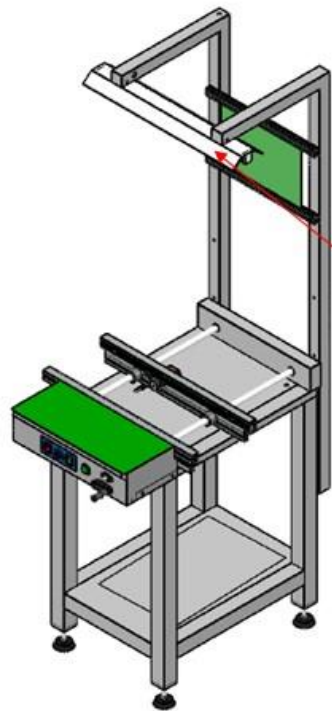


3.5 Lamp cover

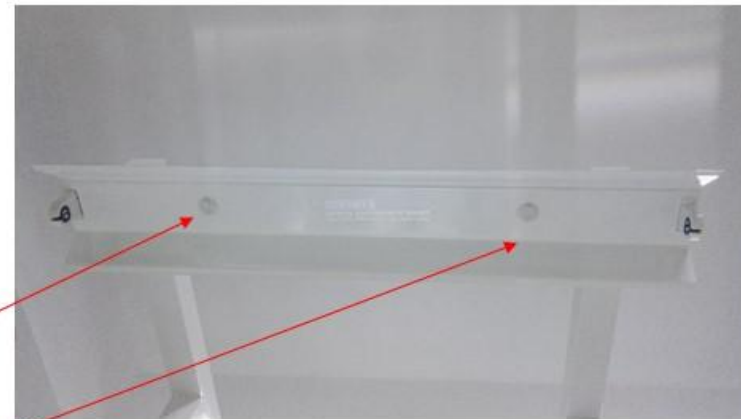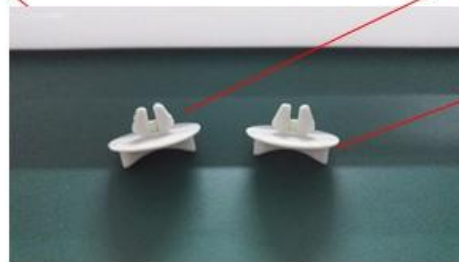

Step 4 :power wire connection installation

4.1, originally with a light, the machine has a terminal inside,
you can directly connect the lamp holder power

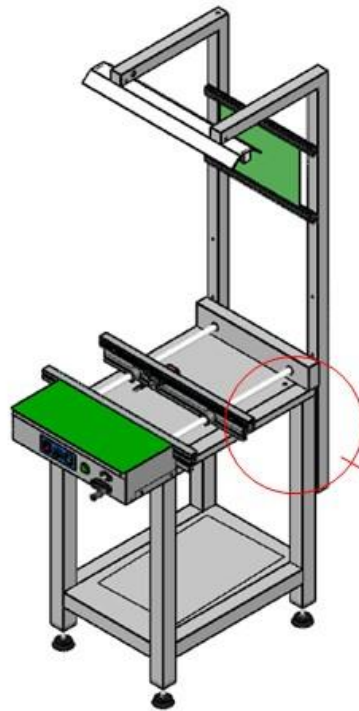


the machine has
a terminal inside



Step 4 : power wire connection installation

4.2, originally without a light, the new light stand, should be directly connected to the internal power supply terminal block

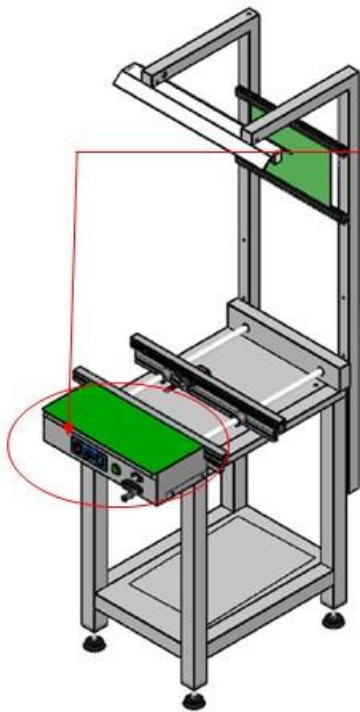

Use new wire connection

Red wire to L, black wire to N

